

# Manhole Inspection Summary

Manhole # S06EE\_022MH

Printed On: 6/24/2010

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **06EE** Node: **022** Status: **Found**

Insp Date: **8/24/09 11:53 AM**

Incomplete Comments

Crew: **RL, ET**  
Inspector: **Lamont**  
Firm: **URS**

**Location** Address: **WILLIAMS ST**

Cross Street: **DIVISION ST**

**Manhole** Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**  
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **32** (in.) Length: (in.) Dist A/B Grade: **0** (in.)  
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**  
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **1** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **3** (in.)  
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated  
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Precast Concrete** ☐ Parged Type: **Concentric/Eccentric**  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated  
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Precast Concrete** ☐ Parged  
Shape: **Circular** Diameter: **48** (in.) Length: (in.)  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated  
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged  
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **9** Missing: **0** ☐ Corroded

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View



Top View



Top View

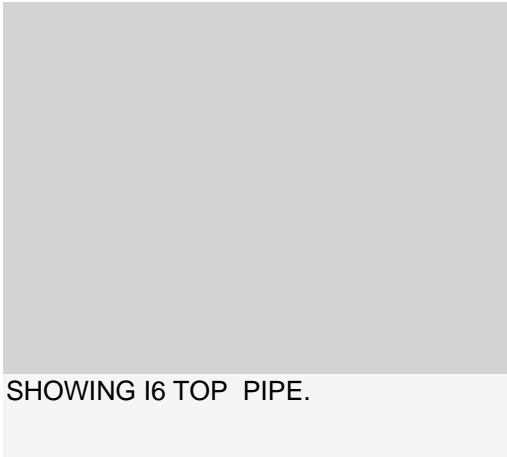


SHOWING I6 TOP PIPE.

GRADE ADJUSTMENT



LOOSE BRICKS

OFFSET



## Manhole Inspection Summary

Manhole # S06EE\_022MH

Printed On: 6/24/2010

Page 3 of 3

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



CHANNEL DEBRIS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **11.52** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow

Drop In @ 6 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **4.44** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **10.42** (ft.)

Inv Depth: **11.42** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection